


**SUBJECT: CIM FLOAT ASSEMBLY WIRE TERMINATIONS**

**Number: 2018-18**  
**Product: CIM Series**  
**Date Issued: November 8, 2018**  
**From: Technical Service**

It has come to our attention that there may be an issue with the assembly and disassembly of the CIM Float Assembly wiring connectors.

When disassembling the wiring harness connectors, **DO NOT** pull on the wires which the Molex wire termination pins are mounted inside the wire connectors.

**DO NOT** pull on the wires when separating the wire connections, the wire may be separated from the internal pin.

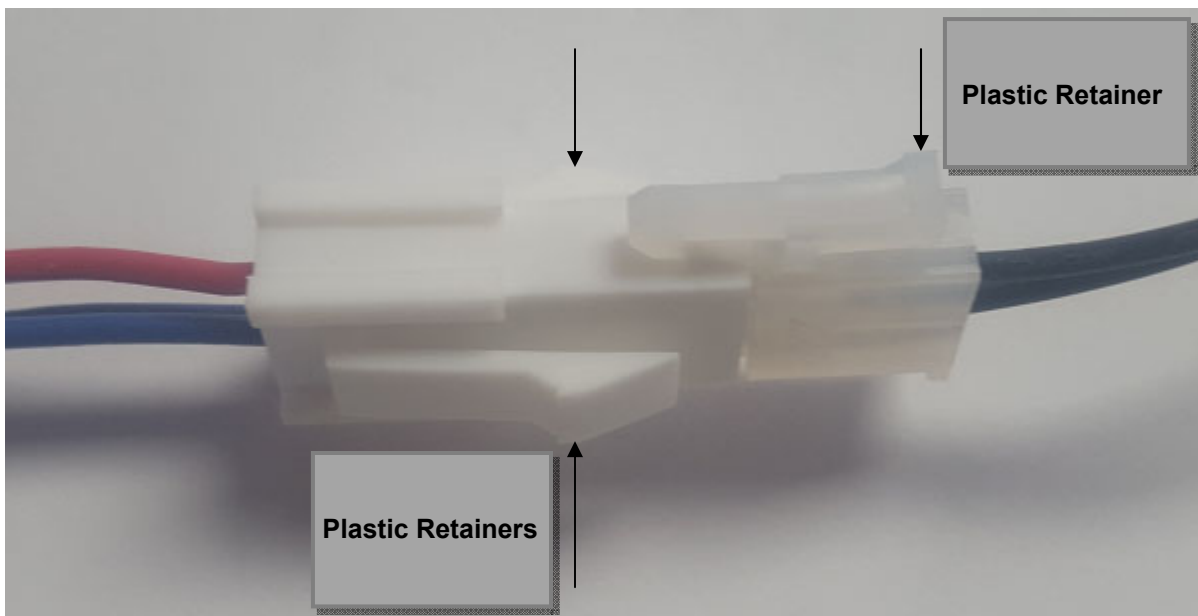

To separate the connectors, depress the two plastic retainers on the female portion of the connector while depressing the locking portion of the male connector; pull the two apart by separating the connectors, **DO NOT PULL** on the connector wires.